TRAIL FORTRESS

BUILT FOR THE TRAIL. CHECKED FOR YOUR TRUCK.

K&N 63-3122 Installation Instructions

Cold Air Intake for Colorado & Canyon (2023-2026)

Part number: 63-3122

trailfortress.com/k-n-performance-air-intake-system-63-3122

Scan for fitment, price and install help

AIRCHARGER HIGH-FLOW INTAKE SYSTEMS


INSTALLATION INSTRUCTIONS

Not legal for sale or use in California on any pollution controlled motor vehicle.

63-3122
CHEVROLET / GMC
2023-25 COLORADO / CANYON
L4-2.7L TURBO

TOOLS NEEDED:

- Ratchet
- Extension
- 7mm socket
- 8mm socket
- 10mm socket
- Pliers
- Flathead screwdriver
- Side cutters
- T30 torx
- T20 torx
- 3mm allen key
- 4mm allen key
- Adjustable wrench

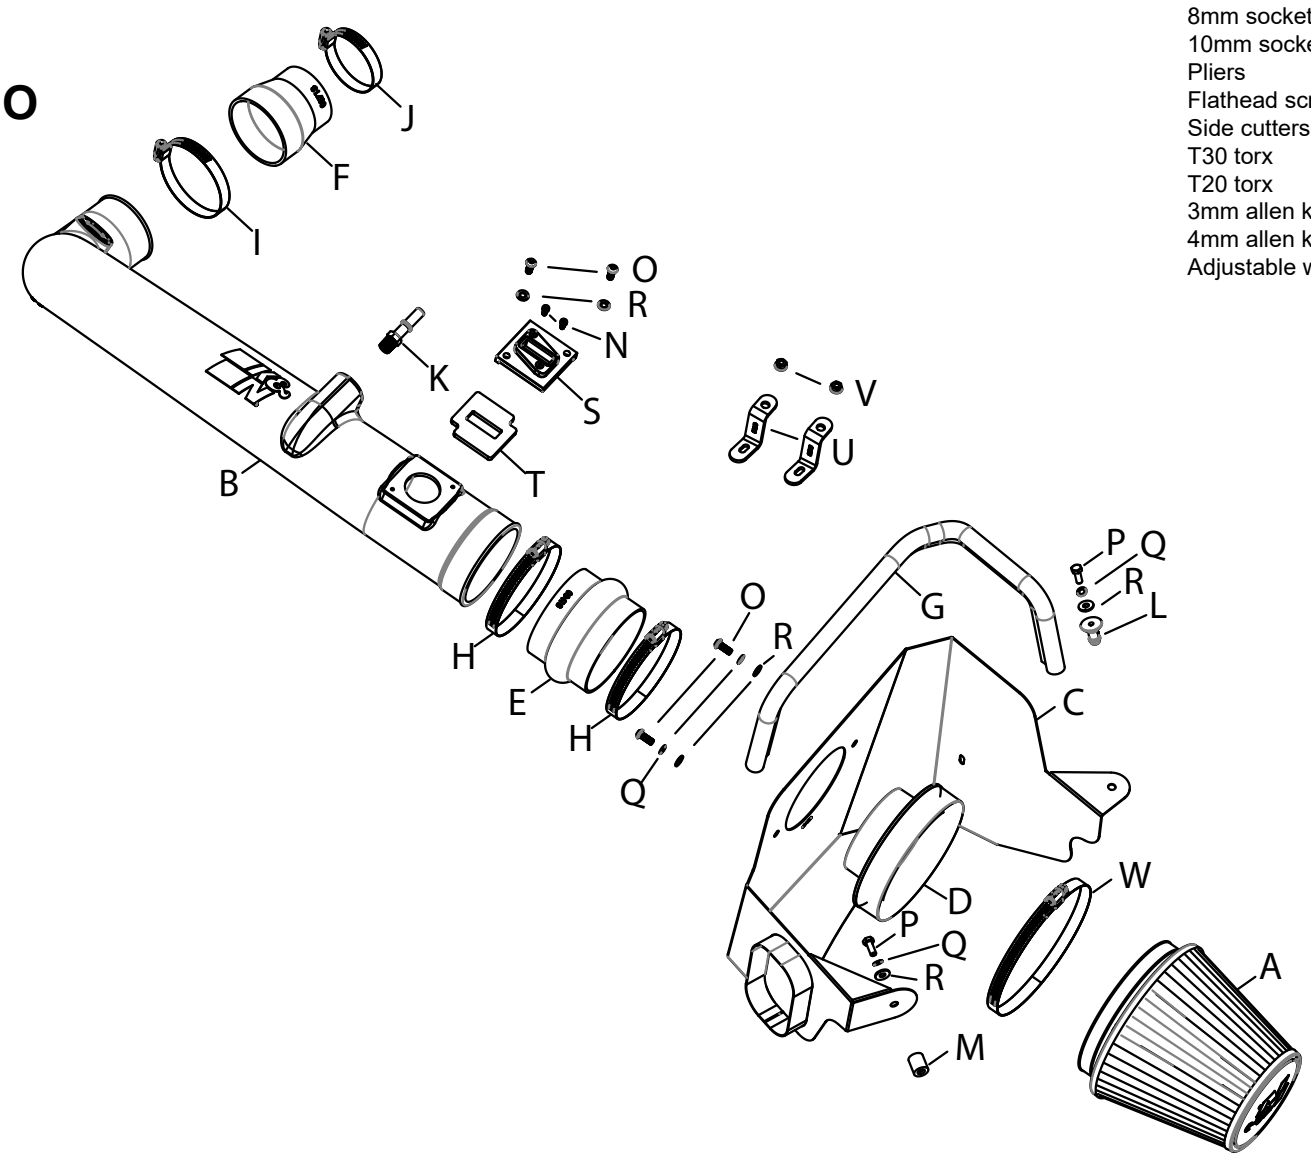

PARTS LIST:

	Description	Qty.	Part #		Description	Qty.	Part #		Description	Qty.	Part #
A	AIR FILTER	1	RU-1042	I	HOSE CLAMP; #48	1	08601	Q	WASHER; M6, SPLIT LOCK	4	1-3025
B	TUBE	1	087584	J	HOSE CLAMP; #40	1	08554	R	WASHER; 6MM FLAT, SS	6	08269
C	HEAT SHIELD	1	074582	K	FITTING; 1/4” NPT	1	088025	S	ADAPTER; MAF SENSOR	1	088032
D	ADAPTOR; FILTER	1	27300	L	MOUNT; PLASTIC NYLON	1	8-186-1	T	GASKET; PORON	1	09069
E	HOSE; HUMP 4”ID X 3”L	1	08418	M	THREADED BOSS; 5/8”OD	1	081004	U	BRACKET; “Z”	2	07958
F	HOSE; 3” TO 2.5”ID X 3”L	1	08713	N	BOLT; M4-.7 X 8MM	2	07733	V	NUT; M6, HEX	2	444.460.04
G	EDGE TRIM; 3/4” @ 55”L	1	102480	O	BOLT; M6 X 1 X 16MM, BH	4	07730	W	HOSE CLAMP; #104	1	08697
H	HOSE CLAMP; #64	2	08645	P	BOLT; M6-1 X 16MM, HEX	2	07812				

If you need any assistance please call 1-800-858-3333 to speak with a representative in our Customer Service Center before returning the product.

NOTE: FAILURE TO FOLLOW INSTALLATION INSTRUCTIONS AND NOT USING THE PROVIDED HARDWARE MAY DAMAGE THE INTAKE TUBE, THROTTLE BODY AND ENGINE.

TO START:

1. Turn off the ignition and disconnect the negative battery cable.

NOTE: Disconnecting the negative battery cable erases pre-programmed electronic memories. Write down all memory settings before disconnecting the negative battery cable. Some radios will require an anti-theft code to be entered after the battery is reconnected. The anti-theft code is typically supplied with your owner’s manual. In the event your vehicles anti-theft code cannot be recovered, contact an authorized dealership to obtain your vehicles anti-theft code.



2. Locate the the red tab on the MAF sensor and slide back, Disconnect the MAF sensor harness. Pull back the MAF harness line away from air box.



3. Depress the locking tab and disconnect the CCV.