TRAIL FORTRESS

BUILT FOR THE TRAIL. CHECKED FOR YOUR TRUCK.

K&N 69-7086TC Installation Instructions

Metal Intake for Nissan Z (2023-2026)

Part number: 69-7086TC


trailfortress.com/k-n-performance-air-intake-system-69-7086tc


Scan for fitment, price and install help

INSTALLATION INSTRUCTIONS

Not legal for sale or use in California on any pollution controlled motor vehicle.

69-7086TC
NISSAN
2023-25 400Z
V6-3.0L Twin turbo

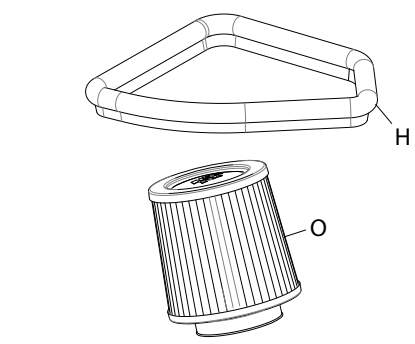

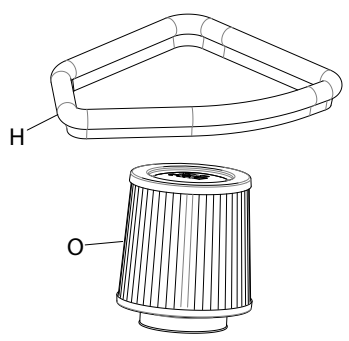

TOOLS NEEDED:

¼" Drive ratchet
10mm socket
8mm socket
¼" Drive universal extension
Long flat blade screw driver
Pliers
Phillips screw driver

PARTS LIST:


	Description	Qty.	Part #		Description	Qty.	Part #		Description	Qty.	Part #
A	SEAL; TUBE TO AIRBOX, 2.75"	2	084166	G	HOSE CLAMP; #44	2	08577	M	AIRBOX; 69-7086, RIGHT SIDE	1	087565
B	SUPER GLUE, 3G DRIP PROOF	1	409	H	EDGE TRIM; 3/4" BULB, 32"L	2	102479	N	AIRBOX; 69-7086, LEFT SIDE	1	087564
C	MAF INSERT; AIR STRTNR	2	9-21070	I	HOSE; 2.75" TO 2"ID X 3"L	1	5-1045	O	AIR FILTER	2	RP-3221
D	VENT; 1/4"NPT 3/8"OD BARB	1	08523	J	HOSE; 2" ID TO 2.75" ID, 40DEF	1	084165	P	HOSE CLAMP; #48	2	08601
E	BADGE; PLASTIC, K&N LOGO	2	088096	K	TUBE; GUNMETAL, DRIVE	1	25924C				
F	HOSE CLAMP; #36	2	08530	L	TUBE; GUNMETAL, PASS	1	25923C				

If you need any assistance please call 1-800-858-3333 to speak with a representative in our Customer Service Center before returning the product.

NOTE: FAILURE TO FOLLOW INSTALLATION INSTRUCTIONS AND NOT USING THE PROVIDED HARDWARE MAY DAMAGE THE INTAKE TUBE, THROTTLE BODY AND ENGINE.

TO START:

1. Turn off the ignition and disconnect the negative battery cable.
NOTE: Disconnecting the negative battery cable erases pre-programmed electronic memories. Write down all memory settings before disconnecting the negative battery cable. Some radios will require an anti-theft code to be entered after the battery is reconnected. The anti-theft code is typically supplied with your owner's manual. In the event your vehicles anti-theft code cannot be recovered, contact an authorized dealership to obtain your vehicles anti-theft code.

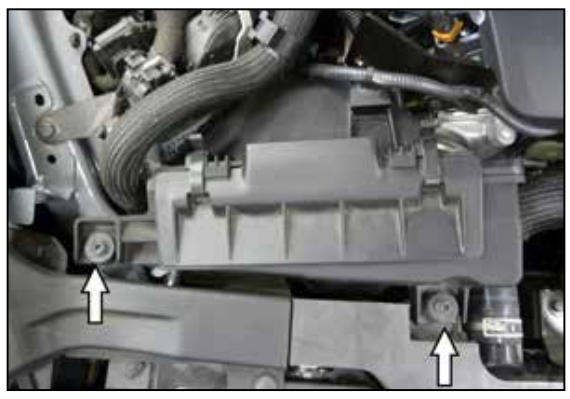

2. Remove the bolts that secure the passenger side air filter housing to the core support.



3. Release the clip holding the coolant hose and remove the clip from the bracket.