TRAIL FORTRESS

BUILT FOR THE TRAIL. CHECKED FOR YOUR TRUCK.

K&N 69-8625TWR Installation Instructions

Metal Intake for Toyota GR Corolla (2023-2025)

Part number: 69-8625TWR

trailfortress.com/k-n-performance-air-intake-system-69-8625twr

Scan for fitment, price and install help

INSTALLATION INSTRUCTIONS

Not legal for sale or use in California on any pollution controlled motor vehicle.

69-8625TWR
TOYOTA
2023-25 GR COROLLA
L3-1.6L TURBO

TOOLS NEEDED:

Ratchet
Extension
10mm Socket
Panel Popper Tool
Phillips Screw Driver
Flat Blade Screwdriver
3mm Allen Key
4mm Allen Key

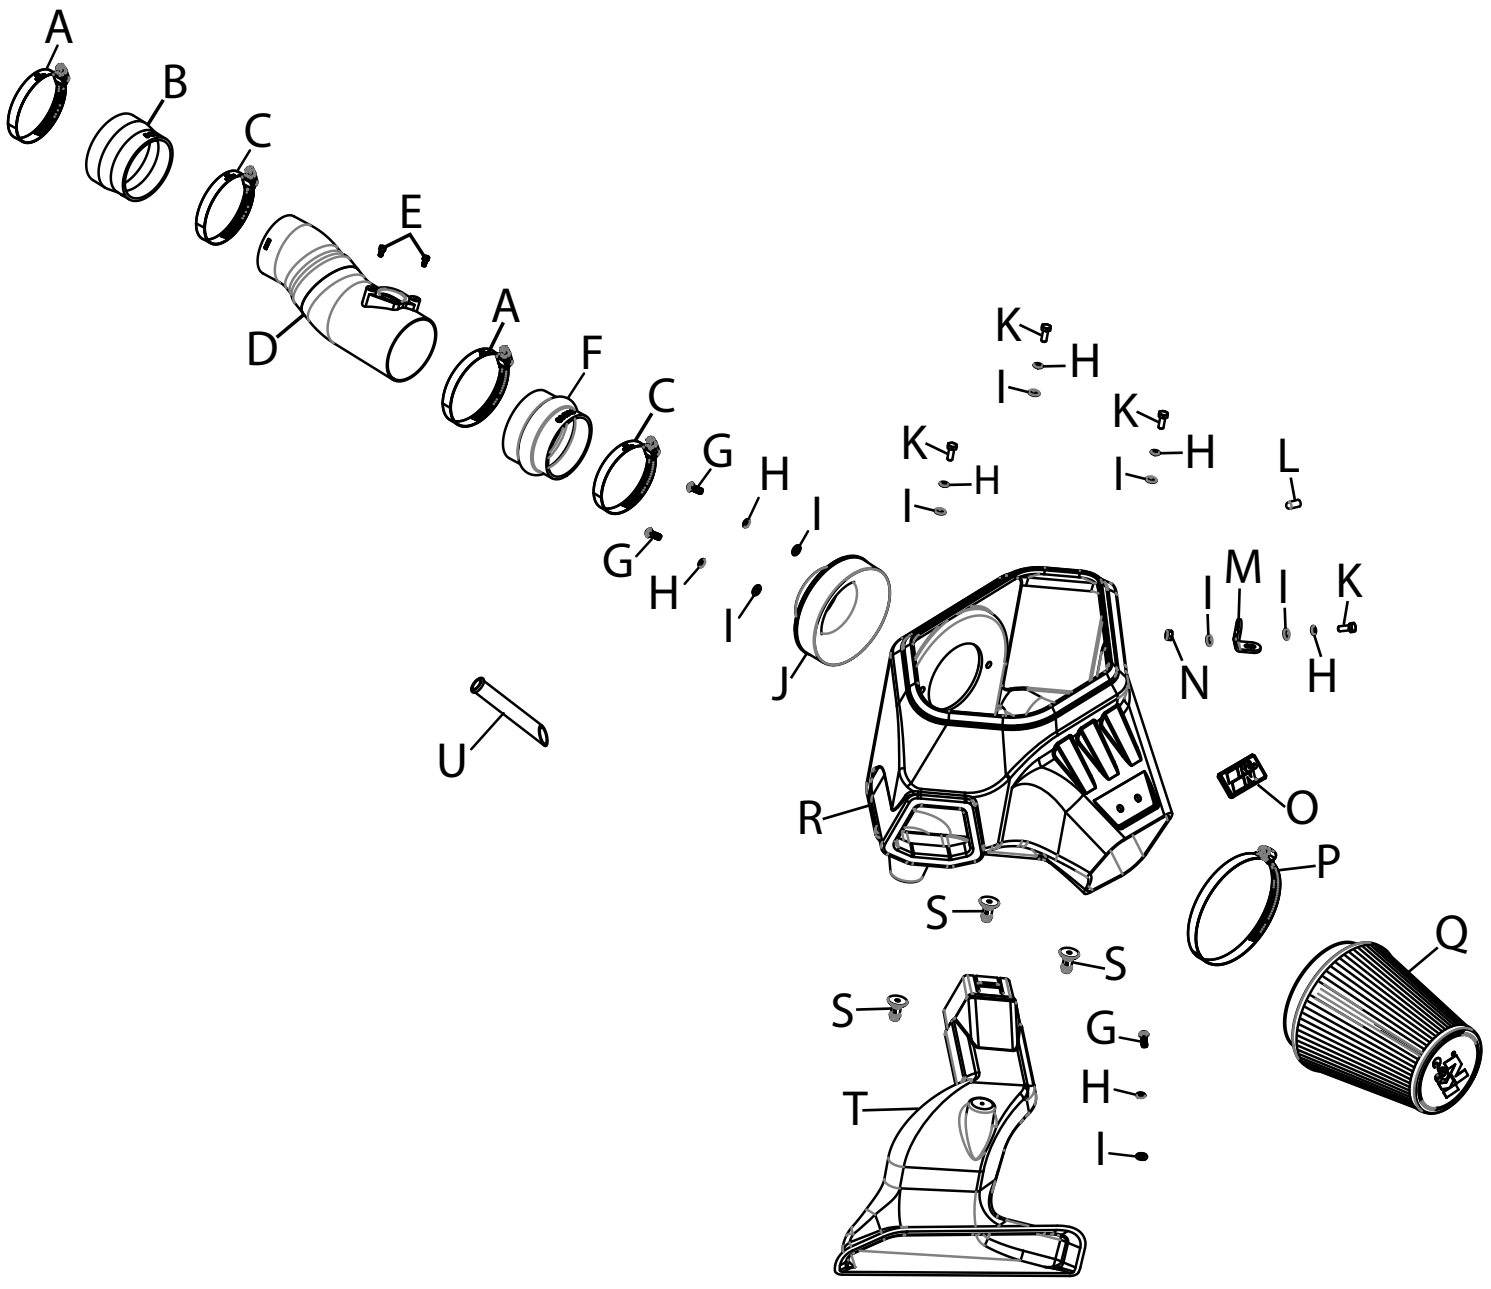

PARTS LIST:

	Description	Qty.	Part #		Description	Qty.	Part #		Description	Qty.	Part #
A	HOSE CLAMP; #52	2	08610	H	WASHER; M6, SPLIT LOCK	7	1-3025	O	BADGE; PLASTIC, SNAP-IN	1	088096
B	HOSE; ADAPTER 3.25/3”X2.25”	1	5-323	I	WASHER; 6MM FLAT	8	08269	P	HOSE CLAMP; #88	1	AIR-KITHS88
C	HOSE CLAMP; #48	2	08601	J	ADAPTER; FILTER, 3”OD	1	21569	Q	AIR FILTER	1	RU-2800
D	TUBE; 3.0”OD TO 3.25”OD	1	25925WR	K	BOLT; M6-1 X 16MM, HEX	4	07812	R	AIRBOX; (RH)	1	087568
E	BOLT; M4-.7 X 8MM, ALNHD CAP	2	07733	L	CAP; RUBBER 5/16”OD X 5/32”ID	1	08282	S	MOUNT; PLASTIC AIRBOX	3	8-186-1
F	HOSE; HUMP, 3”ID TO 3.25”ID	1	084118	M	BRACKET; “L”, SML	1	070066A	T	AIR DUCT; FRESH AIR, (RI)	1	087570
G	BOLT; M6 X 1 X 16MM, BTNHD	3	07730	N	NUT; 6MM NYLOCK, HEXHD	1	07512	U	INSERT; CCV, ALUM	1	088217

If you need any assistance please call 1-800-858-3333 to speak with a representative in our Customer Service Center before returning the product.

NOTE: FAILURE TO FOLLOW INSTALLATION INSTRUCTIONS AND NOT USING THE PROVIDED HARDWARE MAY DAMAGE THE INTAKE TUBE, THROTTLE BODY AND ENGINE.

TO START:

1. Turn off the ignition and disconnect the negative battery cable.
NOTE: Disconnecting the negative battery cable erases pre-programmed electronic memories. Write down all memory settings before disconnecting the negative battery cable. Some radios will require an anti-theft code to be entered after the battery is reconnected. The anti-theft code is typically supplied with your owner’s manual. In the event your vehicles anti-theft code cannot be recovered, contact an authorized dealership to obtain your vehicles anti-theft code.



2. Remove the seven plastic pins that secure the radiator valence and then remove the valence from the vehicle.



3. Remove the four plastic pins that secure the fresh air intake duct sections and then remove both sections of the fresh air duct.