TRAIL FORTRESS

BUILT FOR THE TRAIL. CHECKED FOR YOUR TRUCK.

K&N 69-1508TC Installation Instructions

Metal Intake for Acura TLX (2021-2025)

Part number: 69-1508TC

trailfortress.com/k-n-performance-air-intake-system-69-1508tc

Scan for fitment, price and install help

INSTALLATION INSTRUCTIONS

Not legal for sale or use in California on any pollution controlled motor vehicle.

69-1508TC
ACURA
2021-25 TLX
L4-2.0L

TOOLS NEEDED:

Flat Blade Screw Driver
Phillips Screw driver
Ratchet
Extension
10mm Socket
4mm Allen Key

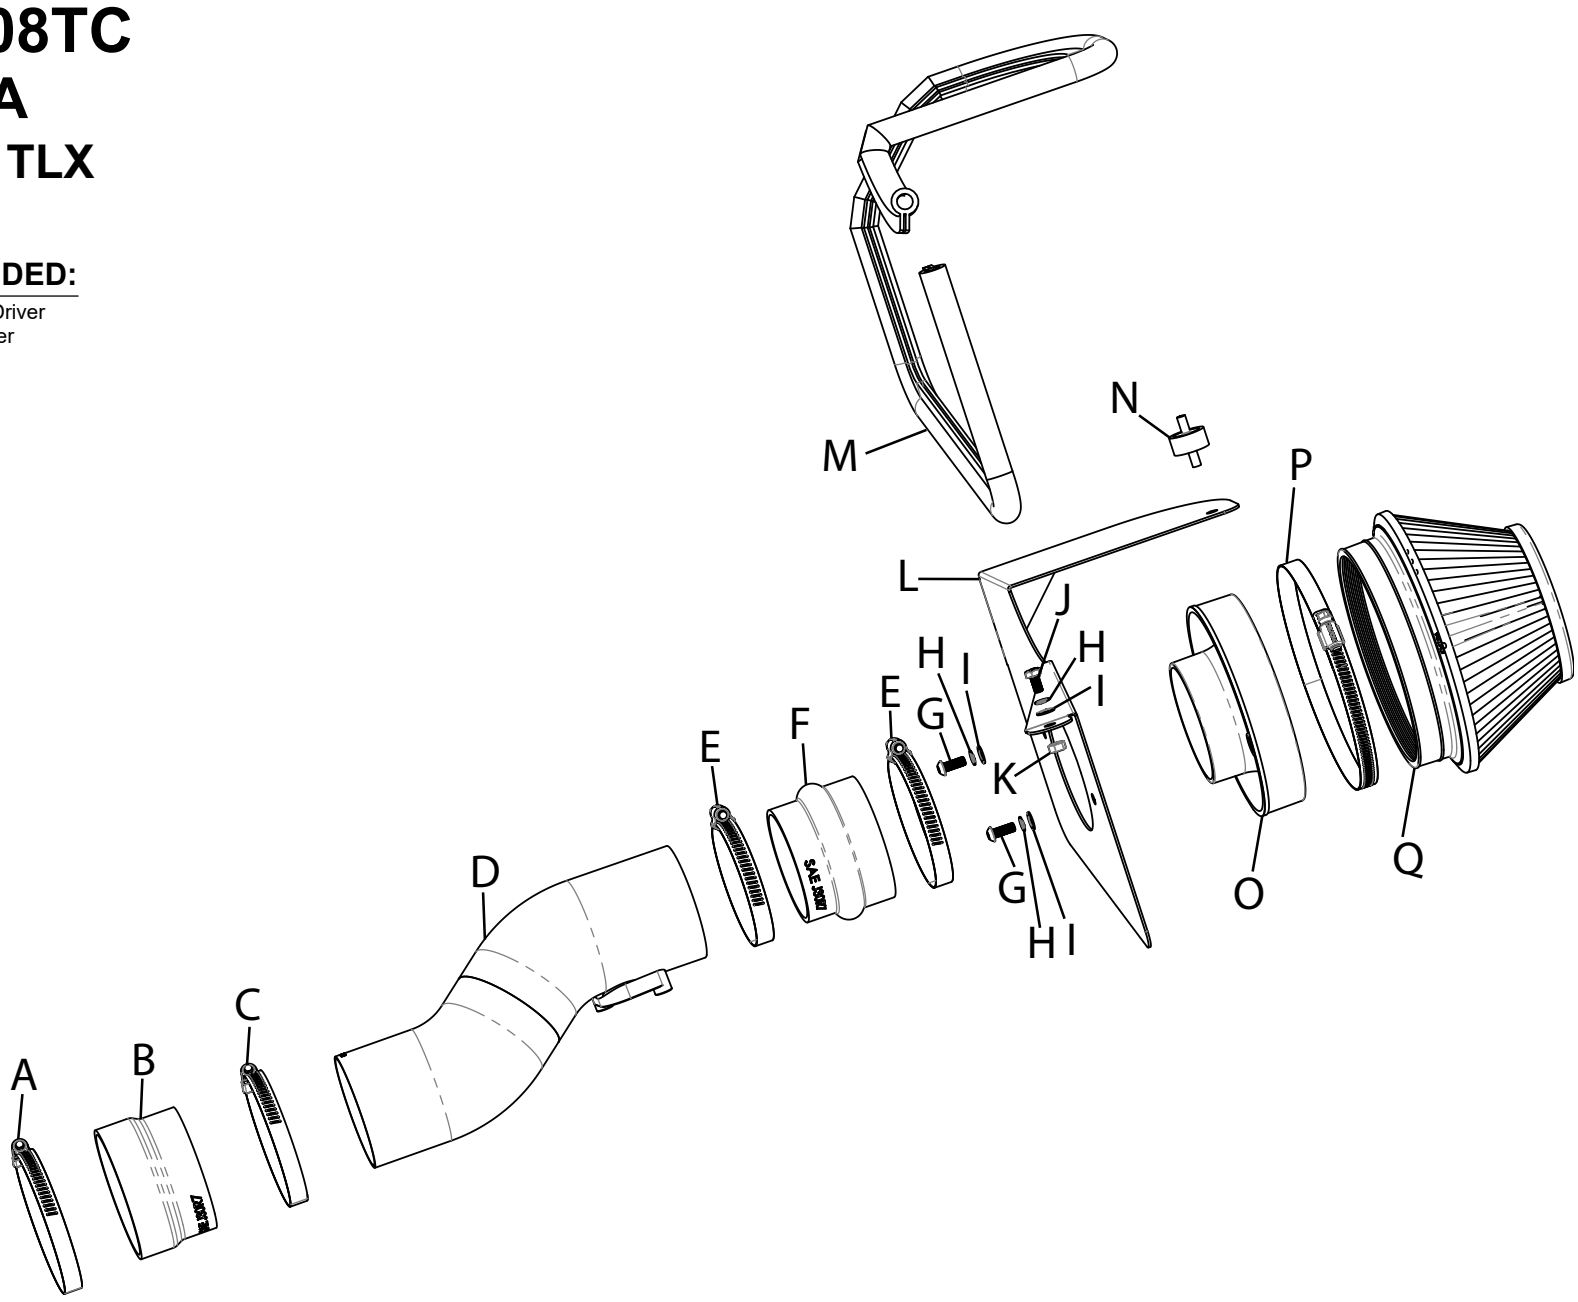

PARTS LIST:

	Description	Qty.	Part #		Description	Qty.	Part #		Description	Qty.	Part #
A	HOSE CLAMP; #56	1	08620	G	BOLT; M6 X 1 X 16MM, BTNHD	2	07730	M	EDGE TRIM; (42”L)	1	102499
B	HOSE; 3.25”ID TO 3.5”ID X 2.25”L	1	084091	H	WASHER; M6 SPLIT LOCK	3	1-3025	N	STUD; M6-1.00 RUBBER	1	07027
C	HOSE CLAMP; #48	1	08601	I	WASHER; 6MM FLAT	3	08269	O	ADAPTER; 3.5” COUPLER	1	21512-1
D	TUBE; 3.25”OD X 12”L	1	25878C	J	BOLT; M6-1 X 16MM, HEX	1	07812	P	HOSE CLAMP; #104	1	08697
E	HOSE CLAMP; #52	2	08610	K	NUT; M6 HEX, SERRATED	1	444.460.04	Q	AIR FILTER	1	RU-4600
F	HOSE; HUMP, 3”ID TO 3.25”ID	1	084118	L	HEAT SHIELD	1	074553				

If you need any assistance please call 1-800-858-3333 to speak with a representative in our Customer Service Center before returning the product.

NOTE: FAILURE TO FOLLOW INSTALLATION INSTRUCTIONS AND NOT USING THE PROVIDED HARDWARE MAY DAMAGE THE INTAKE TUBE, THROTTLE BODY AND ENGINE.

TO START:

1. Turn off the ignition and disconnect the negative battery cable.
NOTE: Disconnecting the negative battery cable erases pre-programmed electronic memories. Write down all memory settings before disconnecting the negative battery cable. Some radios will require an anti-theft code to be entered after the battery is reconnected. The anti-theft code is typically supplied with your owner’s manual. In the event your vehicles anti-theft code cannot be recovered, contact an authorized dealership to obtain your vehicles anti-theft code.



2. Remove the pushpin securing the fresh air duct, then lift the radiator close out panel and remove the fresh air intake duct.



3. Disconnect the mass air sensor electrical connection and unhook the wiring harness from the air filter housing.